

Date: Tuesday, 3/14/2006 3:11:43 PM  
 User: Kim Johnston

## Process Sheet

<b>Customer</b> : CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> : 212/205 HIGH AFT X-TUBE ASSEMBLY
<b>Job Number</b> : 26240	
<b>Estimate Number</b> : 10257	
<b>P.O. Number</b> : N/A	<b>Part Number</b> : D212664201
<b>This Issue</b> : 3/14/2006 <b>S.O. No.</b> : N/A	<b>Drawing Number</b> : D212-664-241 REV B
<b>Prsht Rev.</b> : NC	<b>Project Number</b> : N/A
<b>First Issue</b> : N/A <b>Type</b> : LANDING GEAR	<b>Drawing Revision</b> : B
<b>Previous Run</b> : 25995	<b>Material</b> : N/A
<b>Written By</b> : <i>See Comment Below</i>	<b>Due Date</b> : 4/15/2006 <b>Qty:</b> 1 <b>Um:</b> Each
<b>Checked &amp; Approved By</b> : <i>06.03.14 N</i>	
<b>Comment</b> : Est Rev:E 04.02.16 Reformat K/DS	

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0

DC

DOCUMENT CONTROL

**Comment:** DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D212-664-201CHG002

*06.03.29* (1)

2.0

D6006129

Crosstube material

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6006-129 Crosstube 23970

Check OD = 3.250"; ID = 2.220"

*MS 06/03/19*

3.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8534 on both ends as per Folio FA114

*MS 06/03/19*

2-Turn first side as per Folio FA114

*MS 06/03/19*

3-Deburr &amp; Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241.

*MS 06/03/19*

4.0

QC1

INSPECT ALL DIM TO DIM SHEET

**Comment:** INSPECT ALL DIM TO DIM SHEET

*MS 06/03/19*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 3/14/2006 3:11:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 26240

Part Number: D212664201

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA114

MS 06/03/19

1

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241. MS 06/03/19 1

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

MS 06/03/20

1

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

EN 06/03/20 1

8.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Polish entire outside surface of crosstube

MS 06/03/20

1

2-Remove sand and plugs

MS 06/03/20

1

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241 MS 06/03/20 1

9.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 within 24 hours of machining

SAD 06.03.27

1

10.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 06-4-3

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D212-664-241 using CNC bender program 212-af and Folio FT007

DP 06-4-3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 3/14/2006 3:11:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 26240

Part Number: D212664201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

12.0	QC6	DIMENSIONAL CHECK
------	-----	-------------------



*06-04-10*

Comment: DIMENSIONAL CHECK

13.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
------	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551

*06-04-11*

2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

*06-04-11*

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241

*06-04-12*

14.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 within 24 hours of bending and drilling

*06-04-12*

15.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

16.0	OUTSIDE SERVICE	OUTSIDE SERVICES
------	-----------------	------------------



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 991

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order



*1*

17.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

*06-04-25*

18.0	QC6	DIMENSIONAL CHECK
------	-----	-------------------



Comment: DIMENSIONAL CHECK

Inspect for damage & ensure results are as per Dwg D212-664-241

*06-04-27*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 3/14/2006 3:11:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 26240

Part Number: D212664201

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

FC 06 05 10 ①

ml 06 05 10 ①

20.0

QC14

Inspect Spray Paint



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

06-06-23

21.0

D2856600

Abrasion Strip



Comment: Qty.: 0.8400 f(s)/Unit Total : 0.8400 f(s)

Pick:

Qty Part number Description Batch

2 D2856-600-1009 Abrasion Strip 825656 2T 06-06-27

22.0

D29401

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2940-1 Support 625594 2T 06-06-27

23.0

MS2192028

Clamp



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-28 Clamp M100479 2T 06-06-27

24.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1




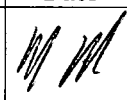
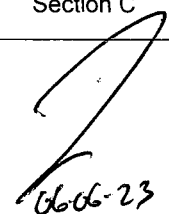
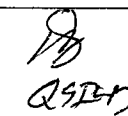
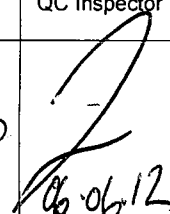
Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8582 2T 06-06-27

2-Install supports and clamps as per Dwg D212-664-241. Torque clamps to 80-100 in lb. 2T 06-06-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☐ No ☒ DQA: ☒ Date: 06/06/30  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06/06/12	19.0	Run in paint on x-tube		Sand out run and re-paint	 06/06/13	 06/06/23	 QSDH	 06/06/12

NOTE: Date & initial all entries



Date: Tuesday, 3/14/2006 3:11:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 26240

Part Number: D212664201

Job Number:



Seq. #: Machine Or Operation: Description :

25.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*DP 6-6-28*

26.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

27.0 D34281 Placard



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

1 D3428-1 PLACARD *B26018*

28.0 AN640A Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

4 AN6-40A Bolt *M100327 1M4P*

29.0 AN641A Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

*24* AN6-41A BOLT *M19633* ✓

30.0 AN960JD616 Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

*18* AN960JD616 Washer *M100191* ✓

31.0 MS21042L6 Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

6 MS21042L6 Nut (or -6) *M19099* ✓

*Pick 6/28 (1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 3/14/2006 3:11:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 26240

Part Number: D212664201

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

*A 06/06/28 ①*

33.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D212-664-201

*NE-B*

*06/06/27 ①*

34.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

*06/06/28 ①*

Job Completion



*U 06.06.29*

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b> 26240
<b>Description:</b> Crosstube Assembly (205/212 High Aft)	<b>Part Number:</b> D212-664-241
<b>Inspection Dwg:</b> D212-664-241 <b>Rev:</b> B	<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	0.200	✓			
	R0.063	+/-0.010	R.063	✓			
	2.990	+0.005/-0.000	2.993	✓			
	5.237	+/-0.030	5.255	✓			
	2.600	+0.005/-0.000	2.604	✓			
	2.686	+0.005/-0.000	2.690	✓			
	2.770	+0.005/-0.000	2.775	✓			
	2.854	+0.005/-0.000	2.859	✓			
	2.938	+0.005/-0.000	2.942	✓			
	3.021	+0.005/-0.000	3.025	✓			
	3.133	+0.005/-0.000	3.137	✓			
	3.179	+0.005/-0.000	3.184	✓			
SIDE B	0.200	+/-0.010	0.200	✓			
	R0.063	+/-0.010	R.063	✓			
	2.990	+0.005/-0.000	2.994	✓			
	5.237	+/-0.030	5.250	✓			
	2.600	+0.005/-0.000	5.603	✓			
	2.686	+0.005/-0.000	2.690	✓			
	2.770	+0.005/-0.000	2.774	✓			
	2.854	+0.005/-0.000	2.858	✓			
	2.938	+0.005/-0.000	2.931	✓			
	3.021	+0.005/-0.000	3.025	✓			
	3.133	+0.005/-0.000	3.137	✓			
	3.179	+0.005/-0.000	3.184	✓			
	124.36	+/-0.020	124.375	✓			

<b>Measured by:</b> MS	<b>Audited by:</b> EP	<b>Prototype Approval:</b>	N/A
<b>Date:</b> 06/03/19	<b>Date:</b> 06/03/20	<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER

PERMISSION IS NOT TO BE HELD FOR A FOREIGNER



DESIGN PH	DRAWN BY PH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D212-664-241	REV. B SHEET 1 OF 3
DATE 05.02.04		TITLE CROSSTUBE ASS'Y (205/212 HI AFT) NTS	
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED  
05.06.09 [Signature]

Qty	Part Number	Description
X	D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
1	D6006-129	CROSSTUBE
2	D2940-1	SUPPORT
2	D2856-600-1009	ABRASION STRIP
4	MS21920-28	CLAMP

#### GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) MATERIAL: MANUFACTURED FROM D6006-129  
FINISHED LENGTH = 124.36±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-600-1009 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2940-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX 241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.






SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 26240

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



RELEASED  
05-02-04

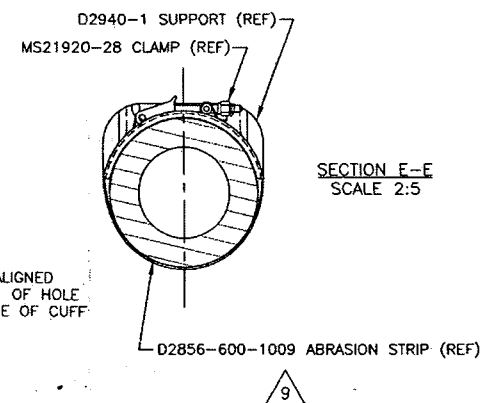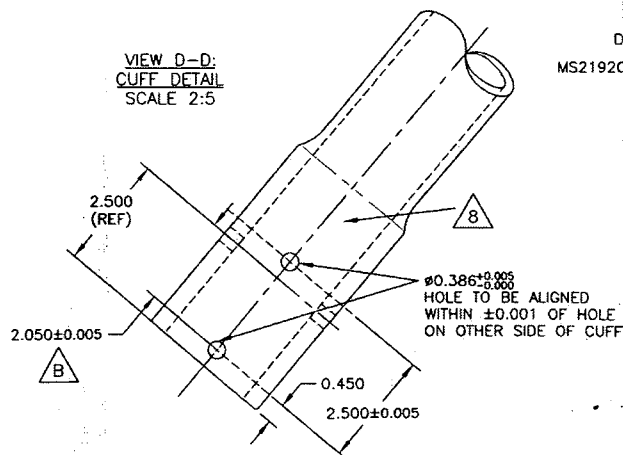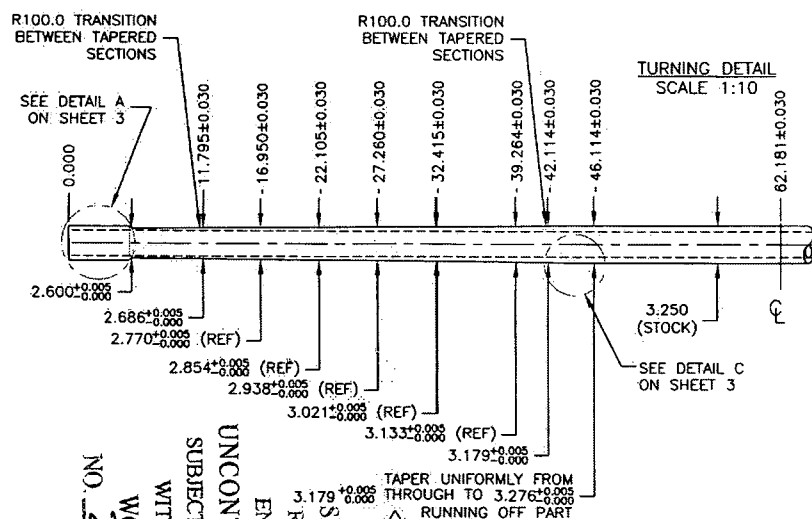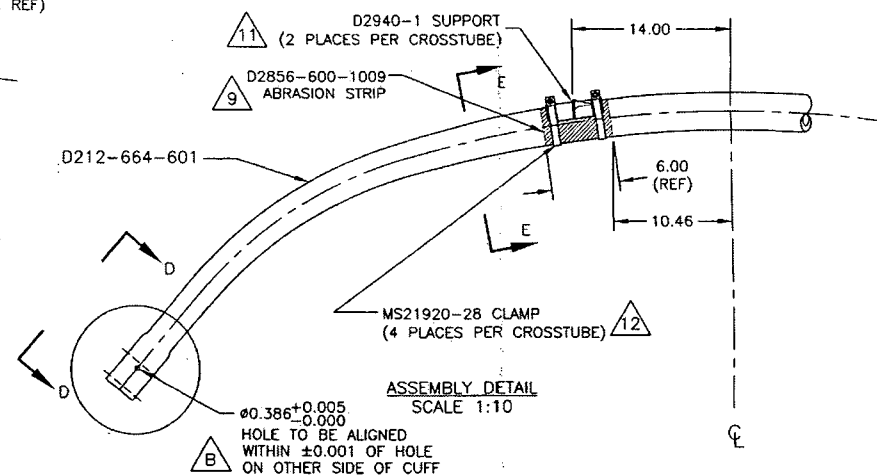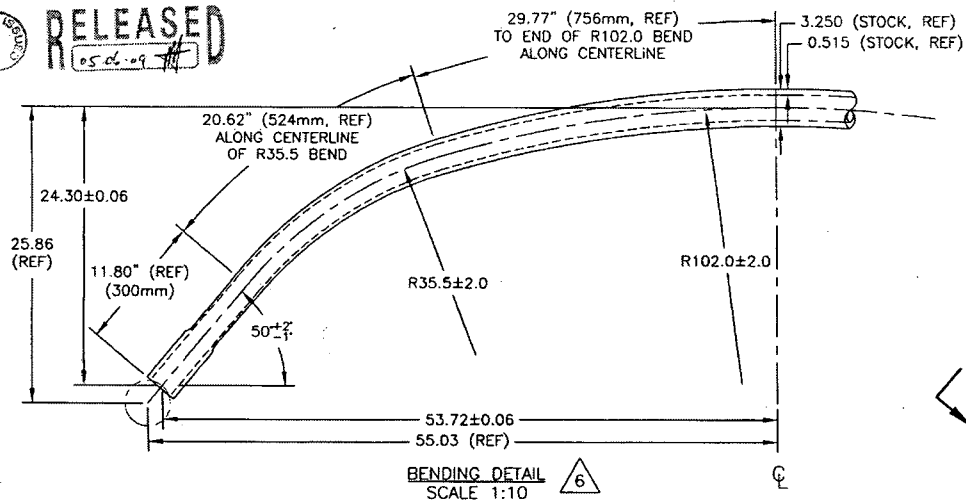

COPYRIGHT © 2000 BY DART AEROSPACE LTD.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	<b>DART</b>	DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
CHECKED H	APPROVED H	DRAWING NO. D212-664-241	REV. B SHEET 2 OF 3
DATE 05.02.04		TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	SCALE 1:10


WORK ORDER  
NO. 26840  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
ENGINEERING  
RETURN TO  
SHOP COPY



RELEASED  
05-06-09

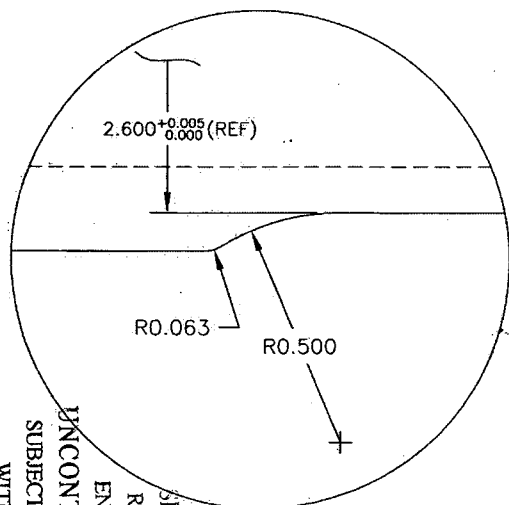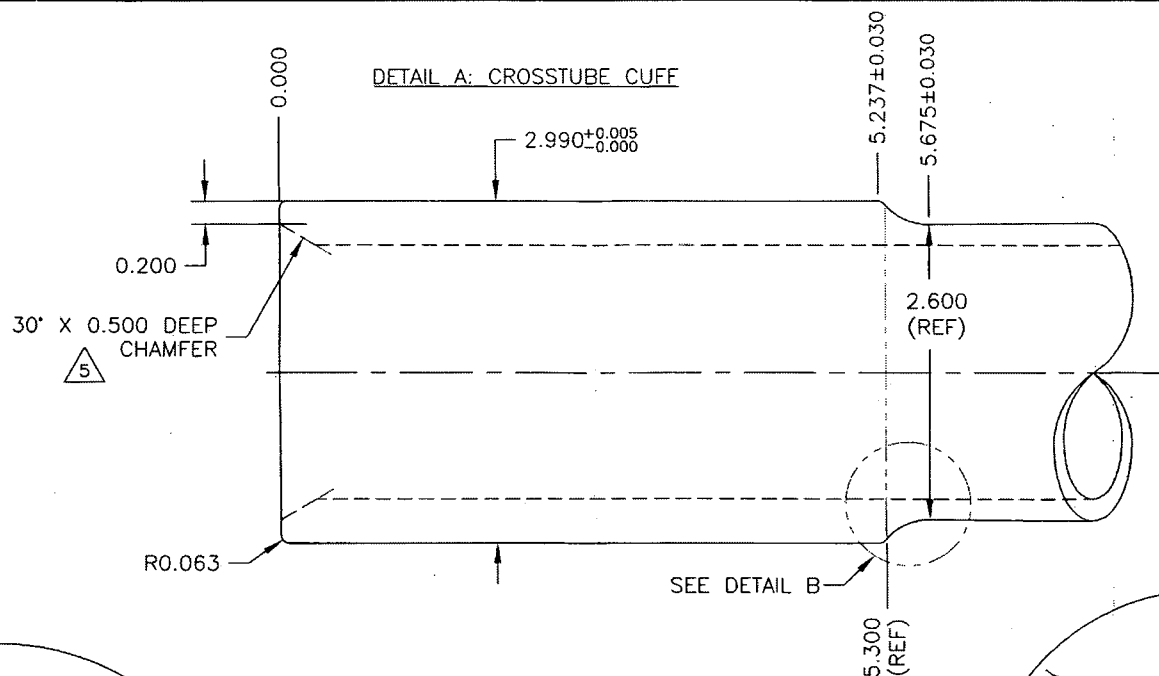


DETAIL C:  
TAPER RUN-OFF  
NOT TO SCALE

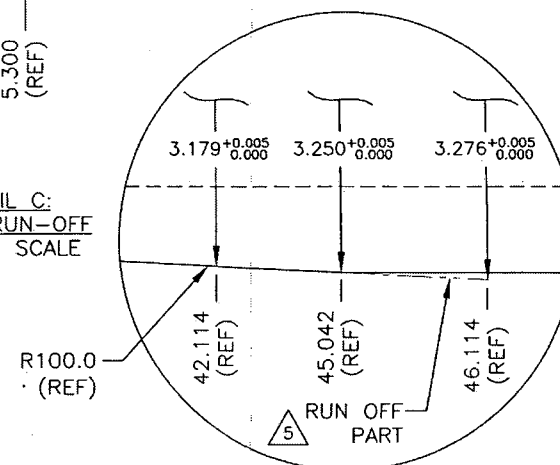


COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN FH	DRAWN BY FH	<b>DART</b>	DART AEROSPACE LTD. MISSISSAUGA, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED #	APPROVED #	DRAWING NO. D212-664-241	REV. B SHEET 3 OF 3
DATE 05.02.04		TITLE CROSSTUBE ASS'Y (205/212 HI AFT)		SCALE 1:1	


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 26240



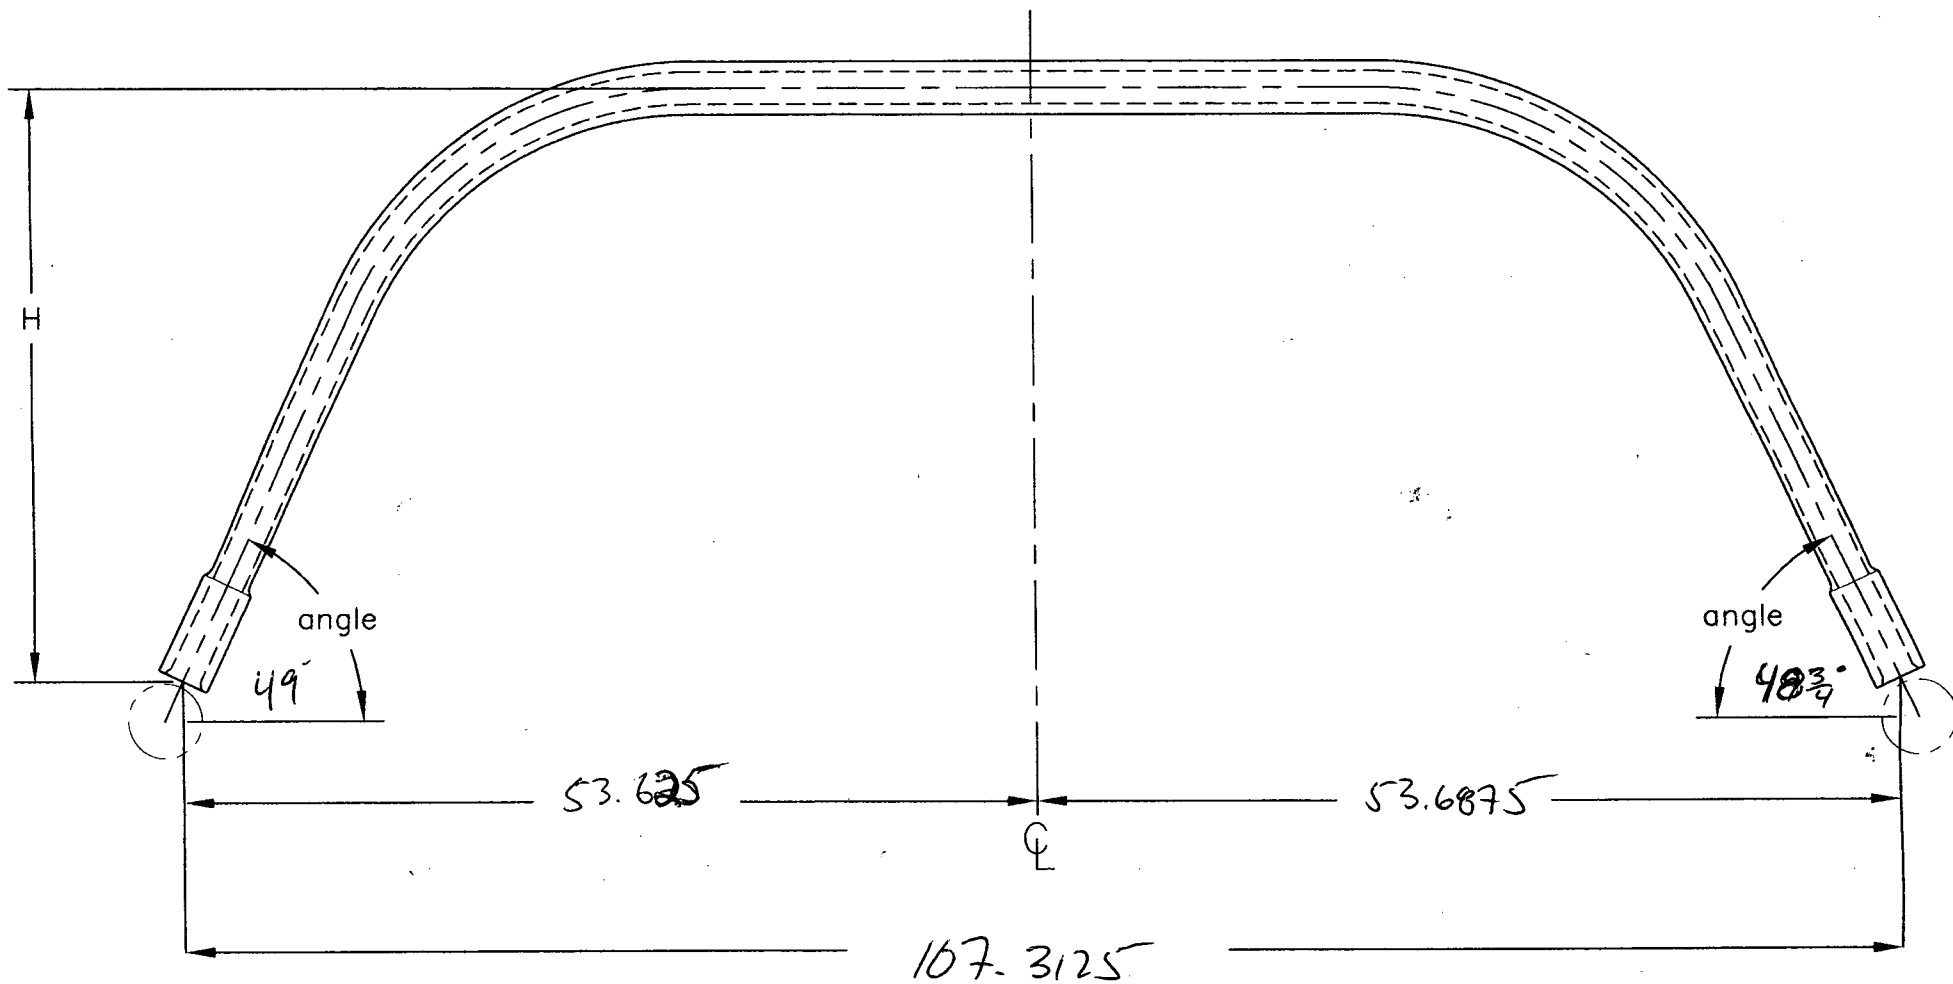

DATE: 06.04.10  
 DESCRIPTION: 212-664-201  
 BATCH NO: 26240  
 DRAWING: 212-664-241  
 H: 24.30  
 1/2 SPAN: 53.72  
 TOTAL SPAN: 107.44  
 ANGLE: 50°  $\pm 1$

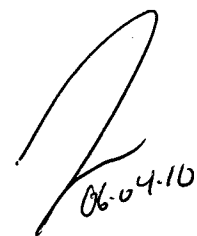  
 06.04.10

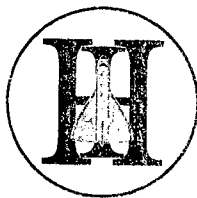

# HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3  
Tél.: (514) 636-1000 • Fax: (514) 636-0031

W.O. N° 33992

A.M.O. Number: 46/90

## NON-DESTRUCTIVE TESTING REPORT

### AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG:

OPERATED BY:

BASED AT:

### INSPECTION REQUIREMENTS

Carry out FPI of (3) cross tube (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty (1) P/N D206-667-203

S/N B25006

Qty (1) P/N D212-664-201

S/N B26240

Qty (1) P/N D212-664-101

S/N B26239



RADIOGRAPHY



ULTRASONIC



PENETRANT



MAGNETIC PARTICLE



EDDY CURRENT

### INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on (3) cross tubes.

Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive)  
Ardrox 970P25E Batch #04B503.

(3) cross tubes PASSED inspection.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH  
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

DATE April 18, 2006

INSPECTION  
STAMP(S)

Not Required

### CUSTOMER INFORMATION

CUSTOMER: Dart Aerospace

P.O. NUMBER 00000991

ADDRESS:

CONTACT NAME:

LABOUR

@

\$

MATERIALS

@

TRAVEL EXPENSES

@

GST

HOTEL EXPENSES

@

PST

INVOICE NO.

TOTAL \$

WHITE COPY - INSPECTION FILE • YELLOW COPY - CUSTOMER • PINK COPY - ACCOUNTANT



# HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3  
Tél: (514) 636-1000 • Fax: (514) 636-0031

W.O. No 33992

A.M.O. Number: 46/90

## NON-DESTRUCTIVE TESTING REPORT

### AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG

OPERATED BY:

BASED AT:

### INSPECTION REQUIREMENTS

Carry out FPI of (3) cross tube (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty (1) P/N D206-667-203 S/N B25006

Qty (1) P/N D212-664-201 S/N B26240

Qty (1) P/N D212-664-101 S/N B26239



RADIOGRAPHY



ULTRASONIC



PENETRANT



MAGNETIC PARTICLE



EDDY CURRENT

### INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on (3) cross tubes.


Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive)

Ardox 970P25E Batch #04B503.

(3) cross tubes PASSED inspection.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH  
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

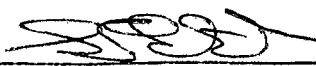  
S. FLETCHER

DATE: April 18, 2006

INSPECTION  
STAMP(S)

Not Required

### CUSTOMER INFORMATION

CUSTOMER: Dart Aerospace

P.O. NUMBER: 00000991

ADDRESS:

CONTACT NAME:

LABOUR

@

\$

MATERIALS

@

TRAVEL EXPENSES

@

GST

HOTEL EXPENSES

@

PST

INVOICE NO.

TOTAL \$

WHITE COPY-INSPECTION FILE • YELLOW COPY-CUSTOMER • PINK COPY-ACCOUNTANT